



Spawning habitat conditions:  None  Poor  Fair  Good  Excellent

Describe spawning habitat: There is some 2" to 4" gravel located at the lower end of the site. There is good brushy cover with a fair amount of instream cover.

Rearing habitat conditions:  None  Poor  Fair  Good  Excellent

Describe pond and other rearing habitat: The first 63 meters has a gravel/cobble substrate, is mostly riffled and is at 5% grade. From 63 meters to 41 meters upstream of Hwy 9, the substrate is silty/mud, the stream is 50% pooled and there is some skunk cabbage and water parsley present. Upstream of this point, the stream appears to be in an old ditchline with hardwoods on the right bank and blackberries on the left bank. The survey ended as the stream forked. The right fork is a small ditch line and the left fork is a small seep.

Describe unaccessible habitat:

Wetland type:  Bog  Marsh  Scrub-shrub  Forested

Describe:

Flooding potential:  Low  Medium  High

Describe: The mainstem meanders through a large swale that sits below this site. There was no evidence of any past flooding problems.

#### FISH INFORMATION

Site entry condition:  Poor  Fair  Good

Describe: There is a large eddy pool present at the entry area.

Coho access and use: Juvenile  Unknown  None  Poor  Fair  Good  
Adult  Unknown  None  Poor  Fair  Good

Describe: Juvenile and adults can access this site but neither were observed during the survey.

Other species acces and use:  Chum  Pink  Sockeye  Chinook  Trout

Describe: This site is accessible to trout also although none were observed during the survey.

ENHANCEMENT OPPORTUNITIES: None

Project type:


Equipment access:

ADDITIONAL COMMENTS: The survey was ended 227 meters upstream of Highway 9 were the stream forked. The right fork is a small ditch line and the left fork is a small seep. The culvert at Highway 9 is LP28 in the culvert inventory.

#### ATTACHMENTS AVAILABLE.

Aerials  Sketch  Maps  Spawning Surveys  Juvenile Trapping  
 Other References


Site id. code: P12RB14  
 Site name:  
 Scale: 1" = 40m  
 Observer(s): OLS  
 Legal location: SW 1/4 S9 T32N R5E

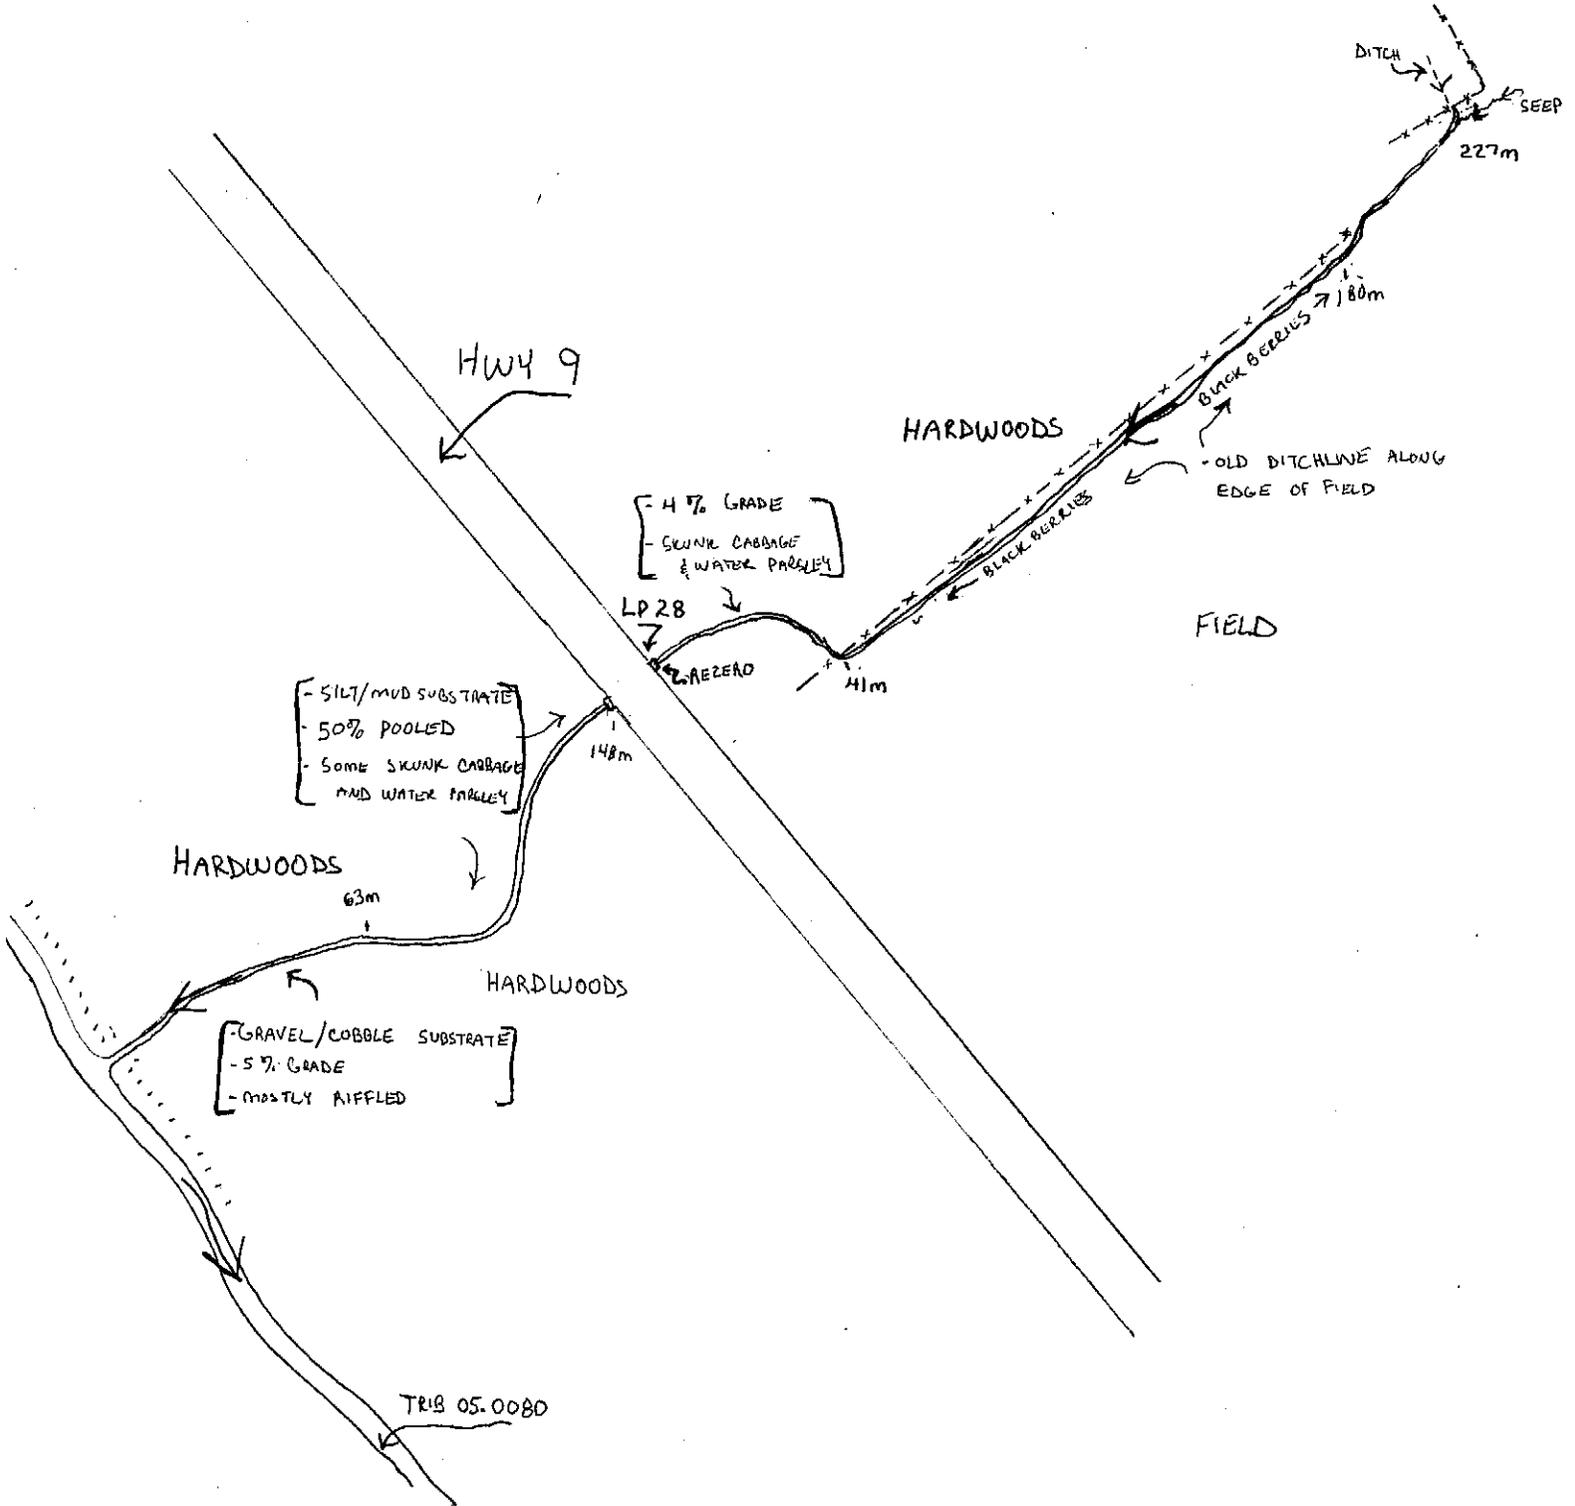

P12RB14

SKAGIT CO  
SNOHOMISH CO

T 33 N  
T 32 N

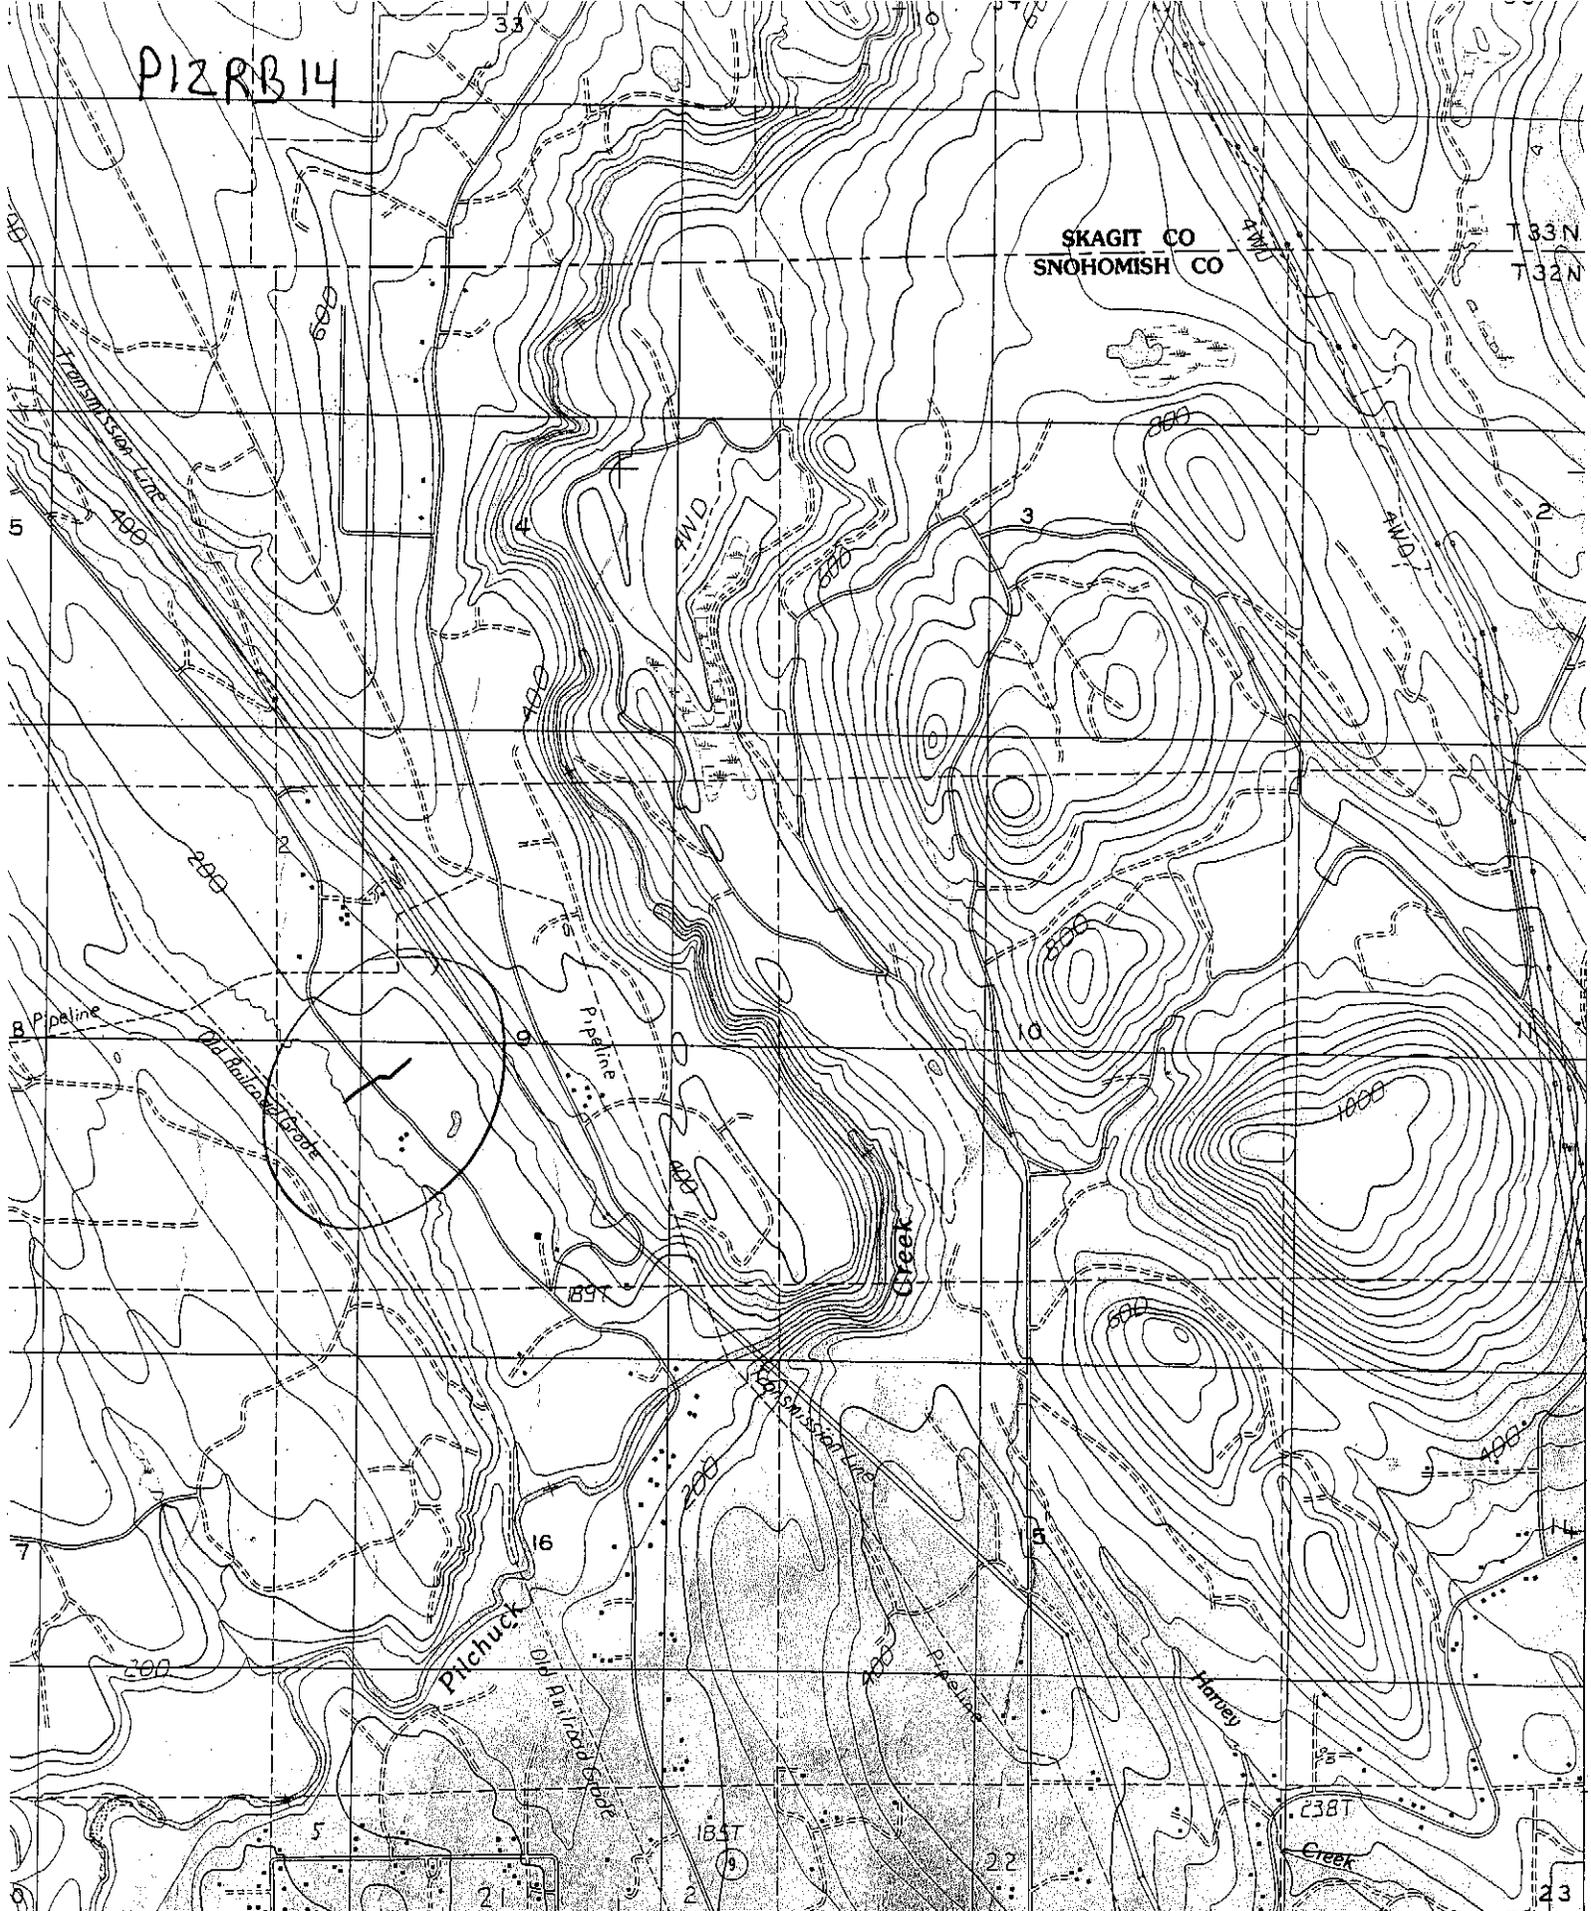

560 561 562 563 564000E 122° 0'

SCALE 1:24 000

KILOMETERS  
METERS 1000

ROAD LEGEND

PIZRB14


RM 0.9

SW 1/4 S9 T32 R5E

X-1590951

Y-1077003

3-19-01

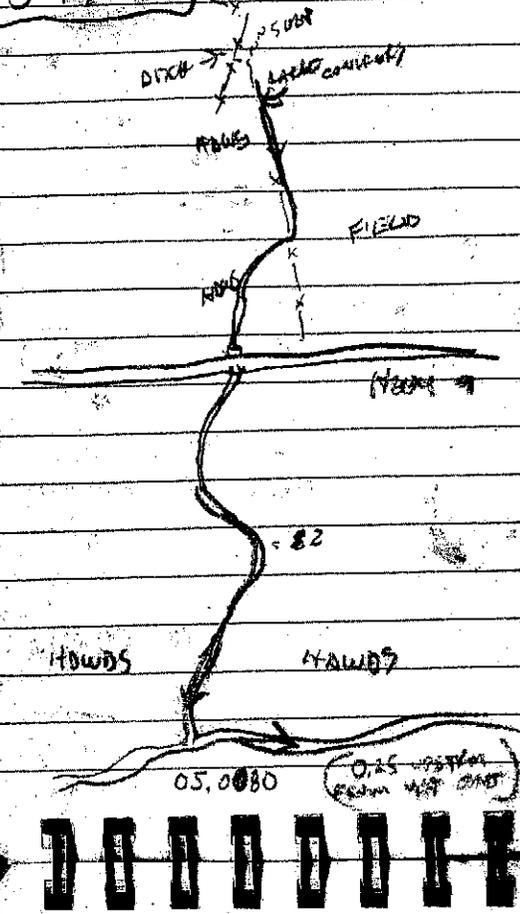

0.0 ENTRY

FLOW 0.3 CFS  
 WT - 45.5°  
 RWT - 44°  
 ACCESS - 6000  
 (EDDY POOL)

6.3m ww 1m  
 - GRAVEL / COBBLE  
 - MOSTLY RIFF 25% POOLED  
 - 5% SAND  
 - 4% SP.  
 - 2-4" GRAVEL

14.8m ww 1.2m  
 - SILT / MUD SUBSTR  
 - 50% POOLED

140m

SKUNK CABB. - WALK PASSES

- @ HWY 9 & CANYON

163m WEST. END OF  
CULV.

(WALK RETURN) 46°

(4-25-CONTINUOUS)  
REZERO @ HWY 9

41m WALK 1m

- SLOW - WALK - PASSES - 40%

- SKI CABB. - WATER TV

180m WALK 0.8m

- POSSIBLE OLD DITCHLINE

FROM WALK OF FLOOD

- BLACKBERRIES ON LB - WOODS

ALL BERRY ON RB

227m WALK 1m

- SLOW - MOIST SUNDAY

- HEAVY BLACK BERRIES

- DITCH ON RB

SLEEP ON LB

- END OF SURVEY

### Comments

- LOW FLOOD

- GROUND WALK - SPRING?

- GOOD HAD.

- NO FISH OBSERVED

- YOUNG ROUNDS?