

**SITE INFORMATION**

**Site Identifier :** SA1LB2 **Landowner Type :**  
**Site Name :** **Landowner Name :**  
**WRIA :** 03.0673X **Address :**  
**Region :** NS **Address2 :**  
**Trib to :** Sauk R **City :**  
**River Mile :** 1.60 **State :**  
**River System :** Sauk R **Zipcode :**  
**Legal Description :** NW1/4S2T34NR9E **Phone :**  
**County :** Skagit  
**Habitat Type :** terrace tributary

**Directions :**

Take highway 20 to Concrete, turn right on the Concrete-Sauk Valley road, and follow to site. See map.

**Area Overview :**

Site is a small, low gradient, mud bottom stream with good cover. Stream is probably intermittent but provides a small amount of good quality overwinter habitat.

**Field Survey Information**

**Date :** 02/25/1996 **Observer :** Barkdull **Survey Type :** initial

**HABITAT INFORMATION**

**Water Source:** ( ) Spring ( ) Groundwater (x) Surface runoff

**Flow:** (x) Intermittent ( ) Year-round

**Estimated Flows (cfs):** Lower end: 0.3  
Upper end: 0.3

**Water Temperature(C):** Lower end: 6  
Upper end: 6

**Receiving Water Temperature (C):** 5

**Other Observations:**

**Site Area Measurements:** ( ) Indirect (x) Direct ( ) Combination

**Widths:** Channel: 0.4 **Ponds:** **Wetlands:**

**Depths:** Channel: 0.2 **Ponds:** **Wetlands:**

**Total length (includes ponds and wetlands):** 88

**Total existing habitat area (est. m2):**

**Spawning area:** Mainstem: 3 **Tribs:** **Total: 3**

**Impounded area:** Mainstem: **Tribs:** **Total:**

**Other rearing area:** Mainstem: 31 **Tribs:** **Total: 31**

**Unaccessible habitat:** Mainstem: **Tribs:** **Total:**

**Spawning habitat conditions:** ( ) None (x) Poor ( ) Fair ( ) Good ( ) Excellent

Describe spawning habitat: one patch of gravel at alluvial fan which may provide spawning for cutthroat but little else.

Rearing habitat conditions:  None  Poor  Fair  Good  Excellent

Describe pond and other rearing habitat: Mixed riffle and pools with good cover, channel bottom is sand and mud.

Describe inaccessible habitat:

Wetland type:  Bog  Marsh  Scrub-shrub  Forested

Describe:

Flooding potential:  Low  Medium  High

Describe: Was not hit by the Nov. 1995 flood

#### FISH INFORMATION

Site entry condition:  Poor  Fair  Good

Describe: A cascade at the mouth is backwatered at moderate flows and passable.

Coho access and use: Juvenile  Unknown  None  Poor  Fair  Good  
Adult  Unknown  None  Poor  Fair  Good

Describe: A few juveniles were observed on the day of the survey, probably no adult use.

Other species access and use:  Chum  Pink  Sockeye  Res. Trout  Anad trout

Describe: Trout use is possible

ENHANCEMENT OPPORTUNITIES: None

Project type:

Equipment access:

#### ADDITIONAL COMMENTS

#### ATTACHMENTS AVAILABLE

Aerials  Sketch  Maps  Spawning Surveys  Juvenile Trapping  
 Other References

Site id. code: SA1LR2  
Site name:  
Section # = 25<sup>m</sup>  
Owner(s): R. B. Hill  
Legal location: NW 2 T34N R9E

clear cut

Concrete - Sauk valley road

Very steep hill

80 metres falls

Alluvial fan

74 m


Colluvium & debris

Rock wall


Am 1.6

Sauk River



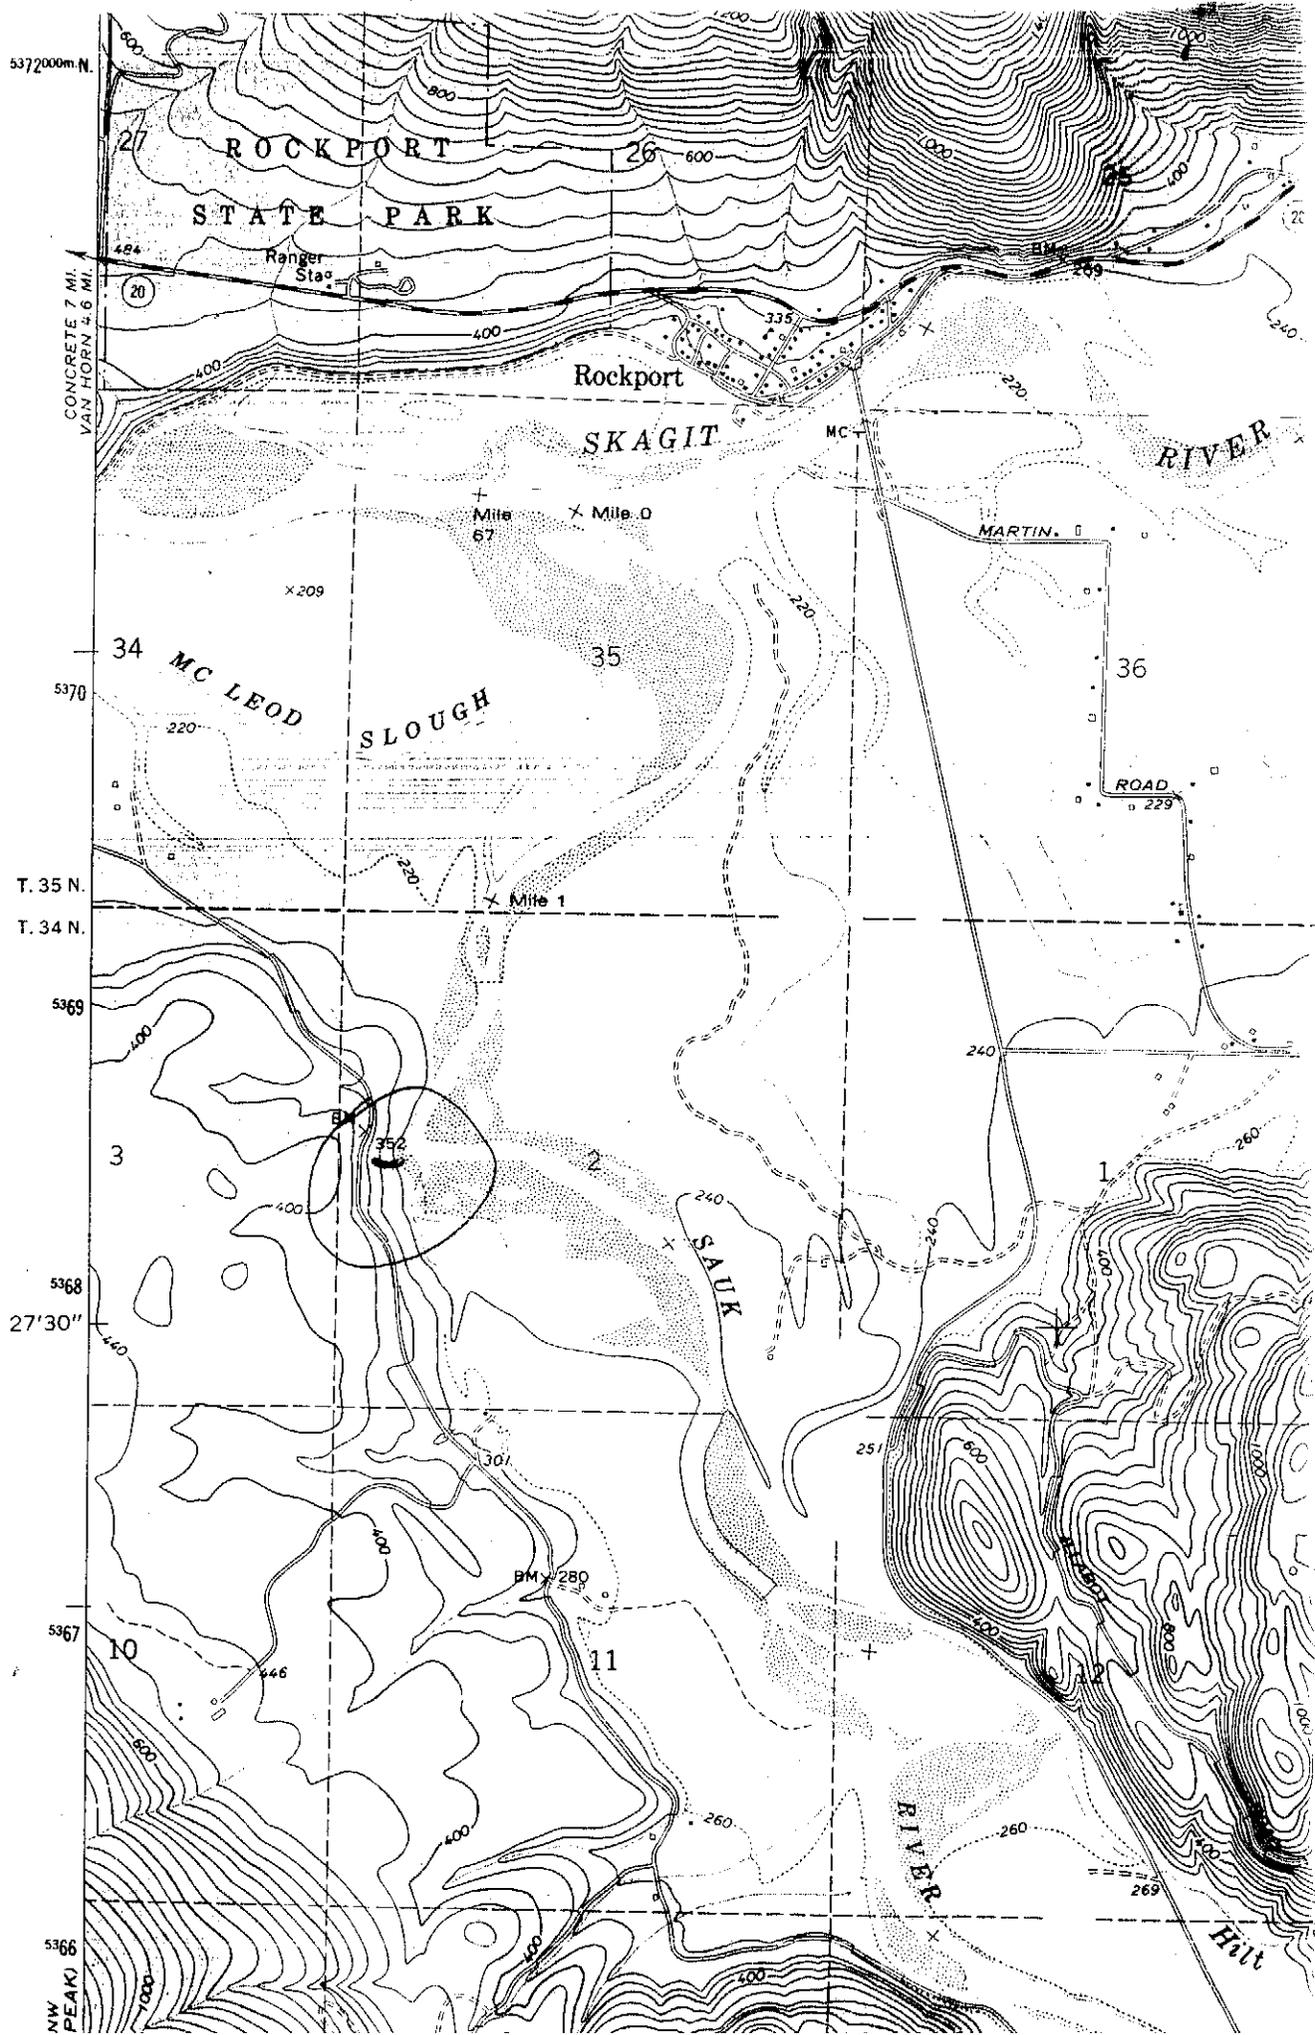

SAILBZ

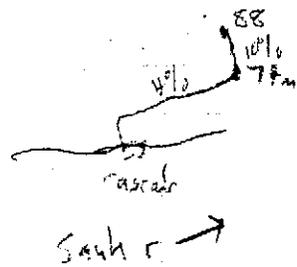

2/25/96 stream Below Bracket Mark  
0.0 0.2 cascade at mouth 4%  
74. 0.8 riffly, mid bottom, good cover  
88. 1.0 gravel, possible rattierot  
spanning 42°, 10% grade