

**SITE INFORMATION**

**Site Identifier :** SU3RB5 **Landowner Type :**  
**Site Name :** **Landowner Name :**  
**WRIA :** 03.0710X **Address :**  
**Region :** NS **Address2 :**  
**Trib to :** Suiattle R **City :**  
**River Mile :** 8.40 **State :**  
**River System :** Suiattle R **Zipcode :**  
**Legal Description :** NE1/4S24T33NR10E **Phone :**  
**County :** Skagit  
**Habitat Type :**

**Directions :**

Take Forest Service # 26 road approximately 0.8 miles past Big Creek to a spur road in a small clear cut area on the right. Park on this spur and walk down to river and site.

**Area Overview :**

Short stream at toe of a steep hill that most likely becomes isolated from river and partially dried up during summer months.

**Field Survey Information**

**Date :** 12/18/1995 **Observer :** Olis **Survey Type :** initial

**HABITAT INFORMATION**

**Water Source:** ( ) Spring (X) Groundwater (X) Surface runoff

**Flow:** (X) Intermittent ( ) Year-round

**Estimated Flows (cfs):** Lower end: 0.2  
Upper end: 0

**Water Temperature(C):** Lower end: 7  
Upper end: 7

**Receiving Water Temperature (C):** 6

**Other Observations:**

**Site Area Measurements:** ( ) Indirect (X) Direct ( ) Combination  
 Widths: Channel: 2m Ponds: Wetlands:  
 Depths: Channel: 0.2m Ponds: Wetlands:  
 Total length (includes ponds and wetlands):240m

**Total existing habitat area (est. m2):**865

<b>Spawning area:</b>	<b>Mainstem:</b>	<b>Tribs:</b>	<b>Total:</b>
<b>Impounded area:</b>	<b>Mainstem:</b>	<b>Tribs:</b>	<b>Total:</b>
<b>Other rearing area:</b>	<b>Mainstem: 865</b>	<b>Tribs:</b>	<b>Total:</b>
<b>Unaccessible habitat:</b>	<b>Mainstem:</b>	<b>Tribs:</b>	<b>Total:</b>

**Spawning habitat conditions:** (X) None ( ) Poor ( ) Fair ( ) Good ( ) Exellent

Describe spawning habitat:

Rearing habitat conditions:  None  Poor  Fair  Good  Excellent

Describe pond and other rearing habitat: Slow moving, shallow stream with lots of structure. Brush and trees standing in water because of high water table.

Describe unaccessible habitat:

Wetland type:  Bog  Marsh  Scrub-shrub  Forested

Describe:

Flooding potential:  Low  Medium  High

Describe: Main flood threat seems to be backwater from the river. Was not affected by Nov. 95 floods except at entry.

#### FISH INFORMATION

Site entry condition:  Poor  Fair  Good

Describe: Although most of the river flow is on the opposite bank, juveniles have to wiggle their way through the roots of a tree that the stream trickles through.

Coho access and use: Juvenile  Unknown  None  Poor  Fair  Good  
Adult  Unknown  None  Poor  Fair  Good

Describe:

Other species access and use:  Chum  Pink  Sockeye  Res. Trout  Anad trout

Describe:

#### ENHANCEMENT OPPORTUNITIES

Project type:


Equipment access:

#### ADDITIONAL COMMENTS


#### ATTACHMENTS AVAILABLE

Aerials  Sketch  Maps  Spawning Surveys  Juvenile Trapping  
 Other References


SUIATTLE

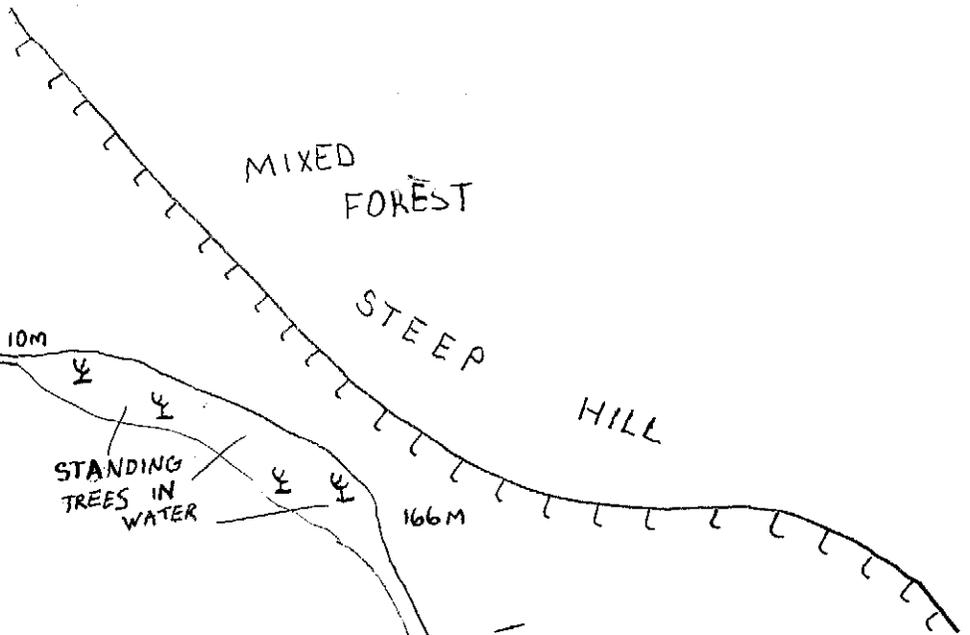

STANDING TREES IN WATER

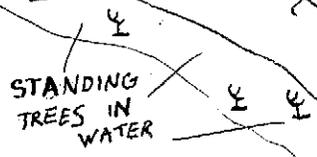


MIXED FOREST

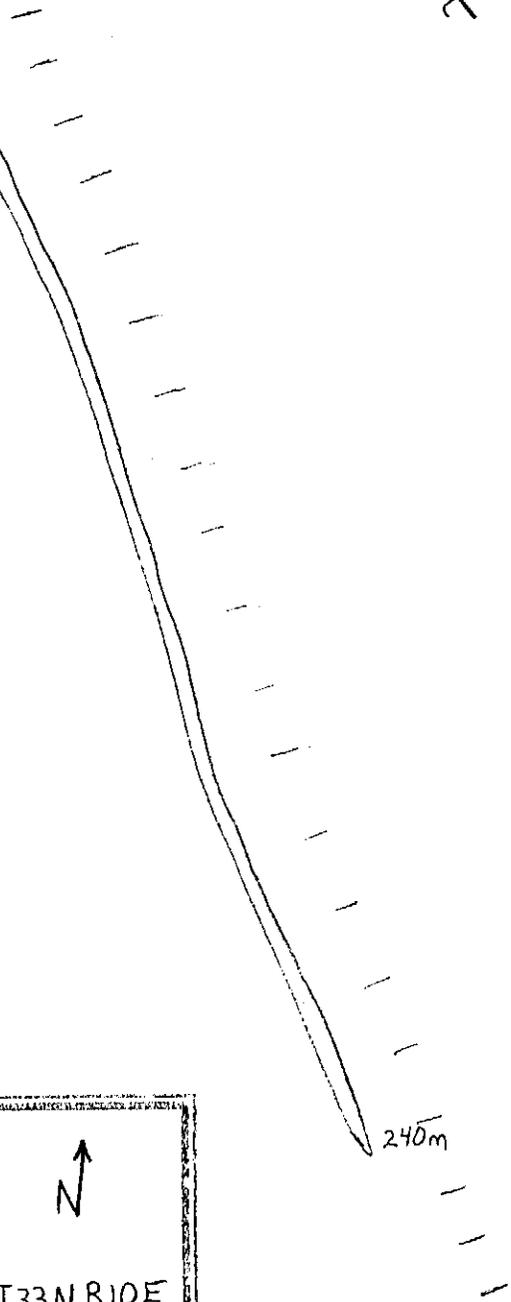


240m

Site id. code: SU3RB5  
Site name:  
Scale: 1" = 25m  
Observer(s): MICHAEL OLIS  
Legal location: NE 1/4 SEC 24 T33N R10E



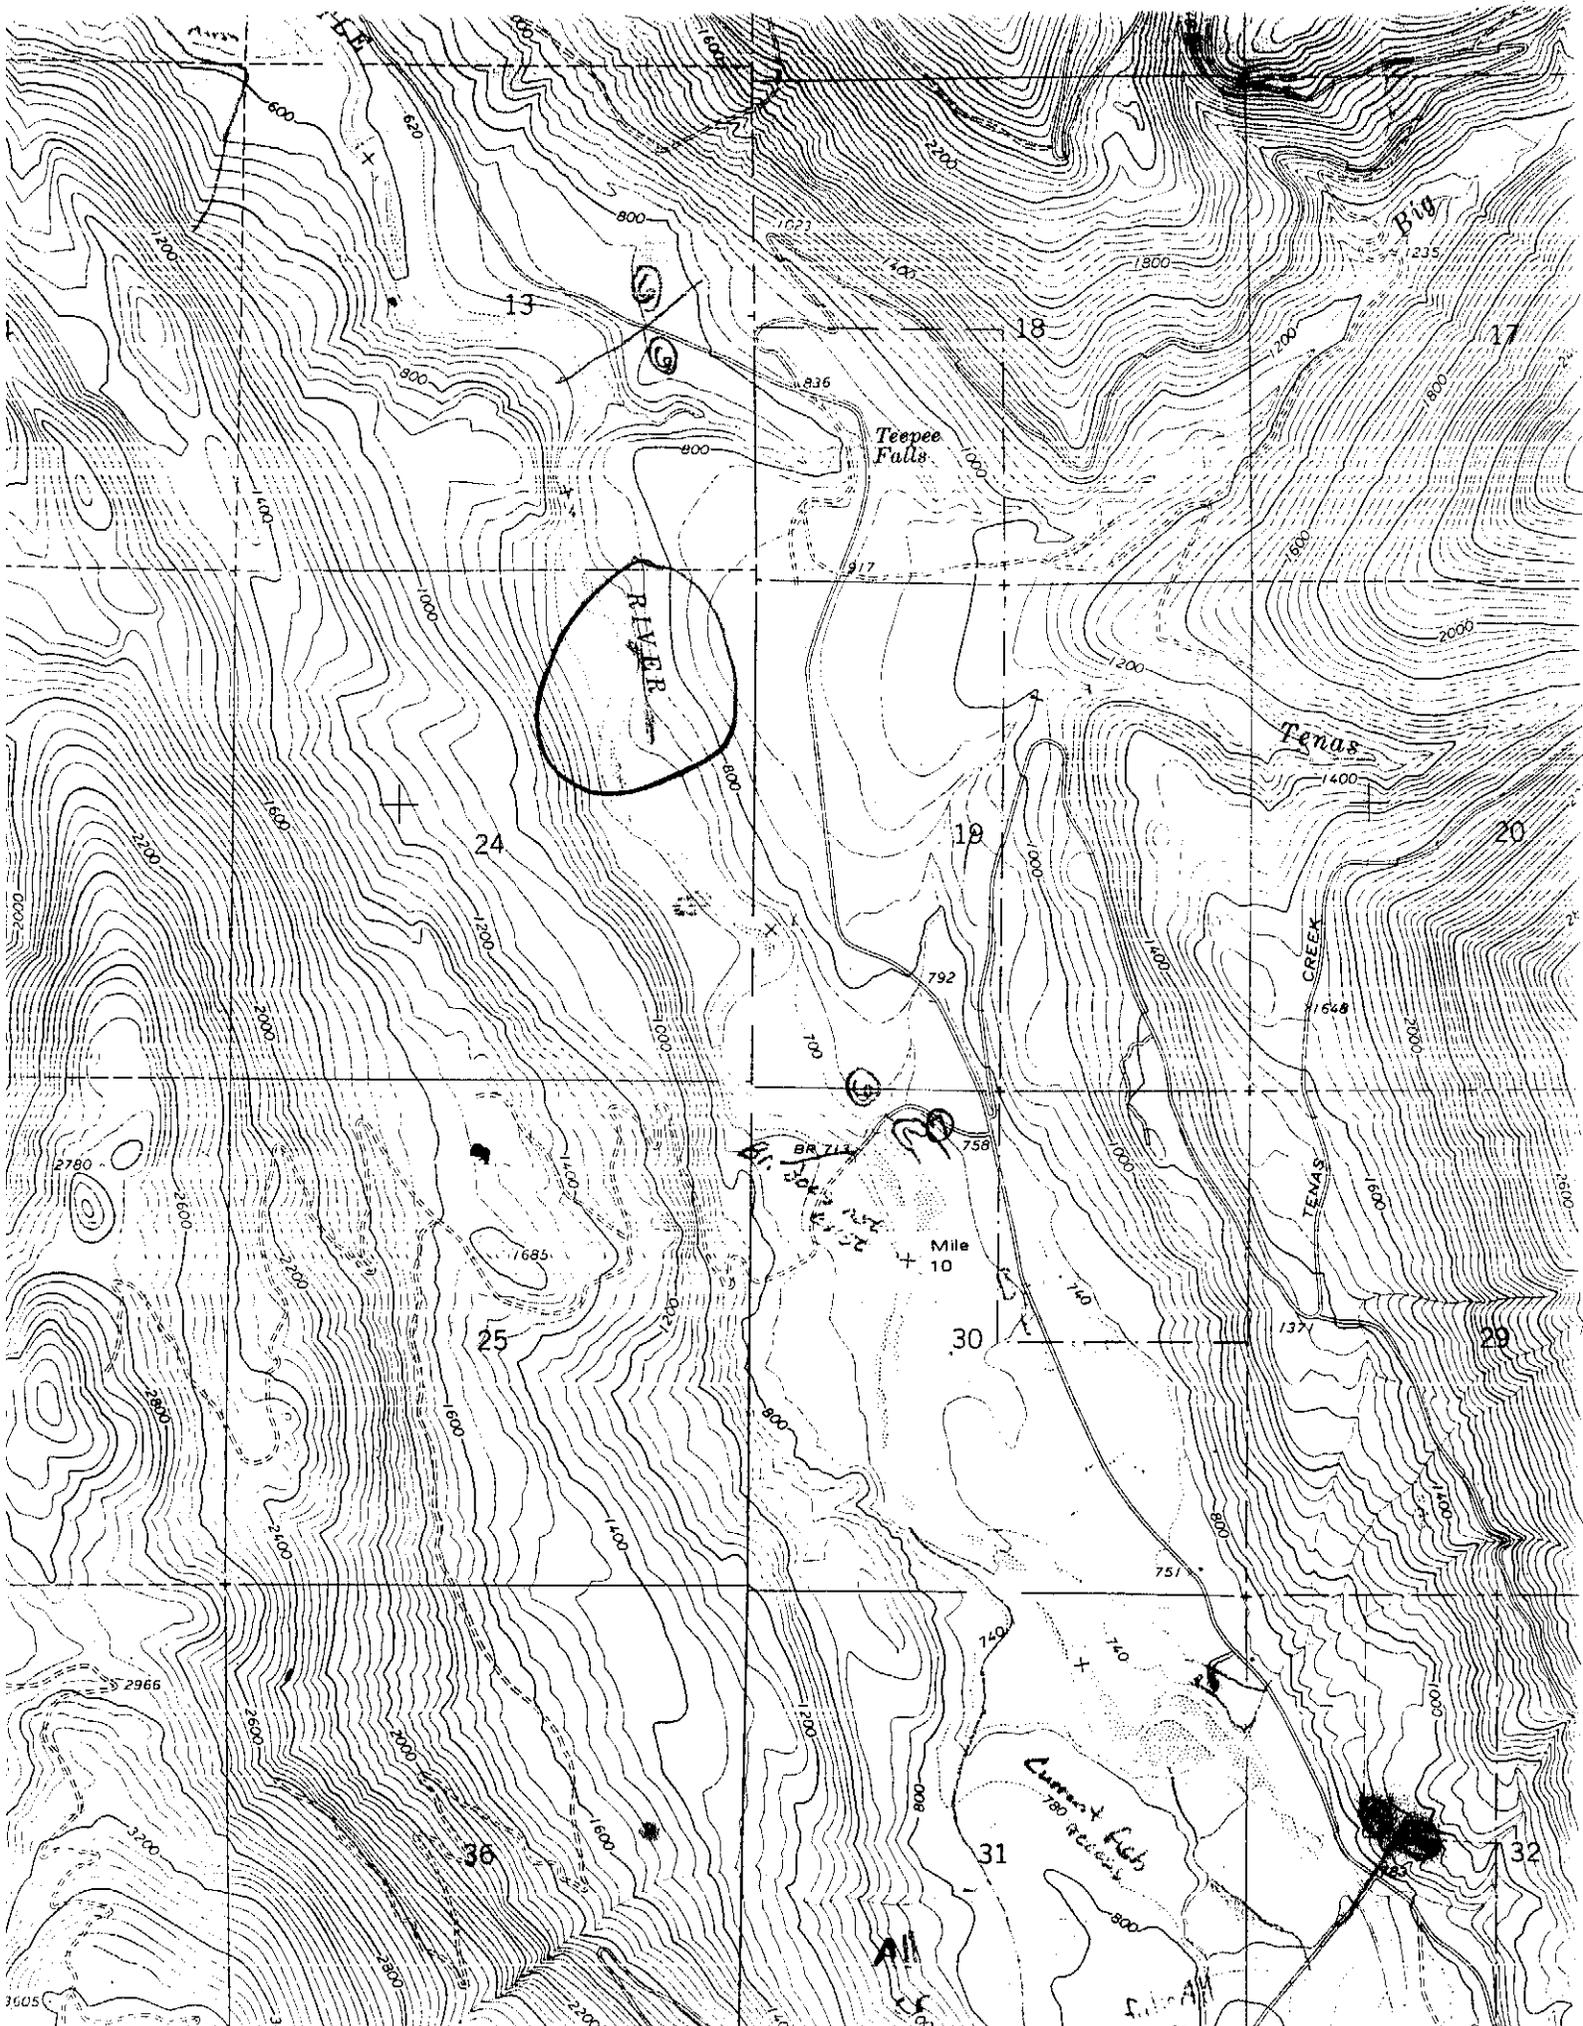

DEC 18

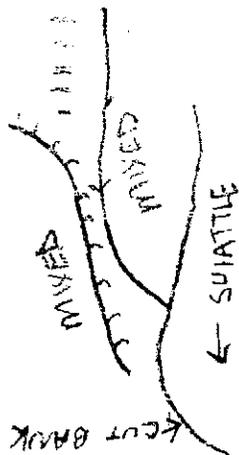

SU3RB5

RM 8.4

NE 1/4 SEC 24 T33N R10E

O.O ENTRY

REC WTR TEMP - 42°

STEM TEMP - 44°

FLOW 0.2 CFS

- NO ADULT ACCESS
- JUV. HAVE FAIR ACCESS
- ACCESS IS LITTERED WITH SILT & DEBRIS
- MOST OF RIVER FLOW IS ON OPPOSITE BANK
- 10m WW .5m RIFF
- SUBSTRATE IS SILTY AND COVERED W/ LEAVES
- THICK W/ BERRY BUSHES

60m WW 10m POOL

- NO APPARENT CHANNEL
- SHALLOW, W/ TREES  
STANDING IN WATER
- THIS AREA MAY  
POSSIBLY DRY OUT  
IN SUMMER

166m WW 2m POOL

- SOME SKUNK CABBAGE  
IN STANDING WATER

240m WW 2m POOL

- END OF FISH ACCESS
- THERE ARE SOME  
ISOLATED POOLS OF  
STANDING WTR AHEAD

### COMMENTS

- SEEMS TO BE  
- SURFACE & GROUND  
WATER FED
- HAS THE APPEARANCE  
OF BEING <sup>mostly</sup> DRIED  
UP DURING SUMMER
- NO FISH SEEN
- WTR TEMP 44
- SEEMED NOT TO  
BE BOTHERED BY  
RECENT FLOOD EXCEPT  
@ ENTRY AREA