

SITE INFORMATION

Site Identifier : SU6LB4 **Landowner Type :** Federal
Site Name : **Landowner Name :** USFS
WRIA : 03.0710X **Address :**
Region : NS **Address2 :**
Trib to : Suiattle R **City :**
River Mile : 20.90 **State :**
River System : Suiattle R **Zipcode :**
Legal Description : NW1/4S20T32NR12E **Phone :**
County : Snohomish
Habitat Type : overflow channel

Directions :

Take forest service # 26 up the Suiattle River, turn right on forest service # 25 and follow to Lime Creek. Site is located 0.1 miles above the mouth of Lime Creek.

Area Overview :

This site consists of two intermittent connected channels that flow across a floody river terrace.

Field Survey Information

Date : 07/25/1995 **Observer :** Barkdull **Survey Type :** initial

HABITAT INFORMATION

Water Source: Spring Groundwater Surface runoff

Flow: Intermittent Year-round

Estimated Flows (cfs): Lower end: 0
Upper end: 0.01

Water Temperature(C): Lower end:
Upper end:

Receiving Water Temperature (C):

Other Observations:

Site Area Measurements: Indirect Direct Combination

Widths: Channel: 3.0 Ponds: Wetlands:

Depths: Channel: 0.01 Ponds: Wetlands:

Total length (includes ponds and wetlands): 465

Total existing habitat area (est. m2): 893

Spawning area: Mainstem: 20 Tribs: 20 Total: 20

Impounded area: Mainstem: Tribs: Total:

Other rearing area: Mainstem: 459 Tribs: 165 Total: 624

Unaccessible habitat: Mainstem: Tribs: 269 Total: 269

Spawning habitat conditions: None Poor Fair Good Excellent

Describe spawning habitat: Substrate composed mainly of cobbles and boulders with small patches of gravel

Rearing habitat conditions: None Poor Fair Good Excellent

Describe pond and other rearing habitat: Riffle dominated with little organic debris or cover.

Describe unaccessible habitat: Similar to accessible habitat.

Wetland type: Bog Marsh Scrub-shrub Forested

Describe:

Flooding potential: Low Medium High

Describe: Site is swept by high energy flooding during larger events.

FISH INFORMATION

Site entry condition: Poor Fair Good

Describe: Channel drops directly into a rapid.

Coho access and use: Juvenile Unknown None Poor Fair Good
Adult Unknown None Poor Fair Good

Describe: A few juveniles were observed on the day of the survey.

Other species access and use: Chum Pink Sockeye Res. Trout Anad trout

Describe: Trout use possible but unknown

ENHANCEMENT OPPORTUNITIES: none


Project type:

Equipment access:

ADDITIONAL COMMENTS

ATTACHMENTS AVAILABLE

Aerials Sketch Maps Spawning Surveys Juvenile Trapping
 Other References

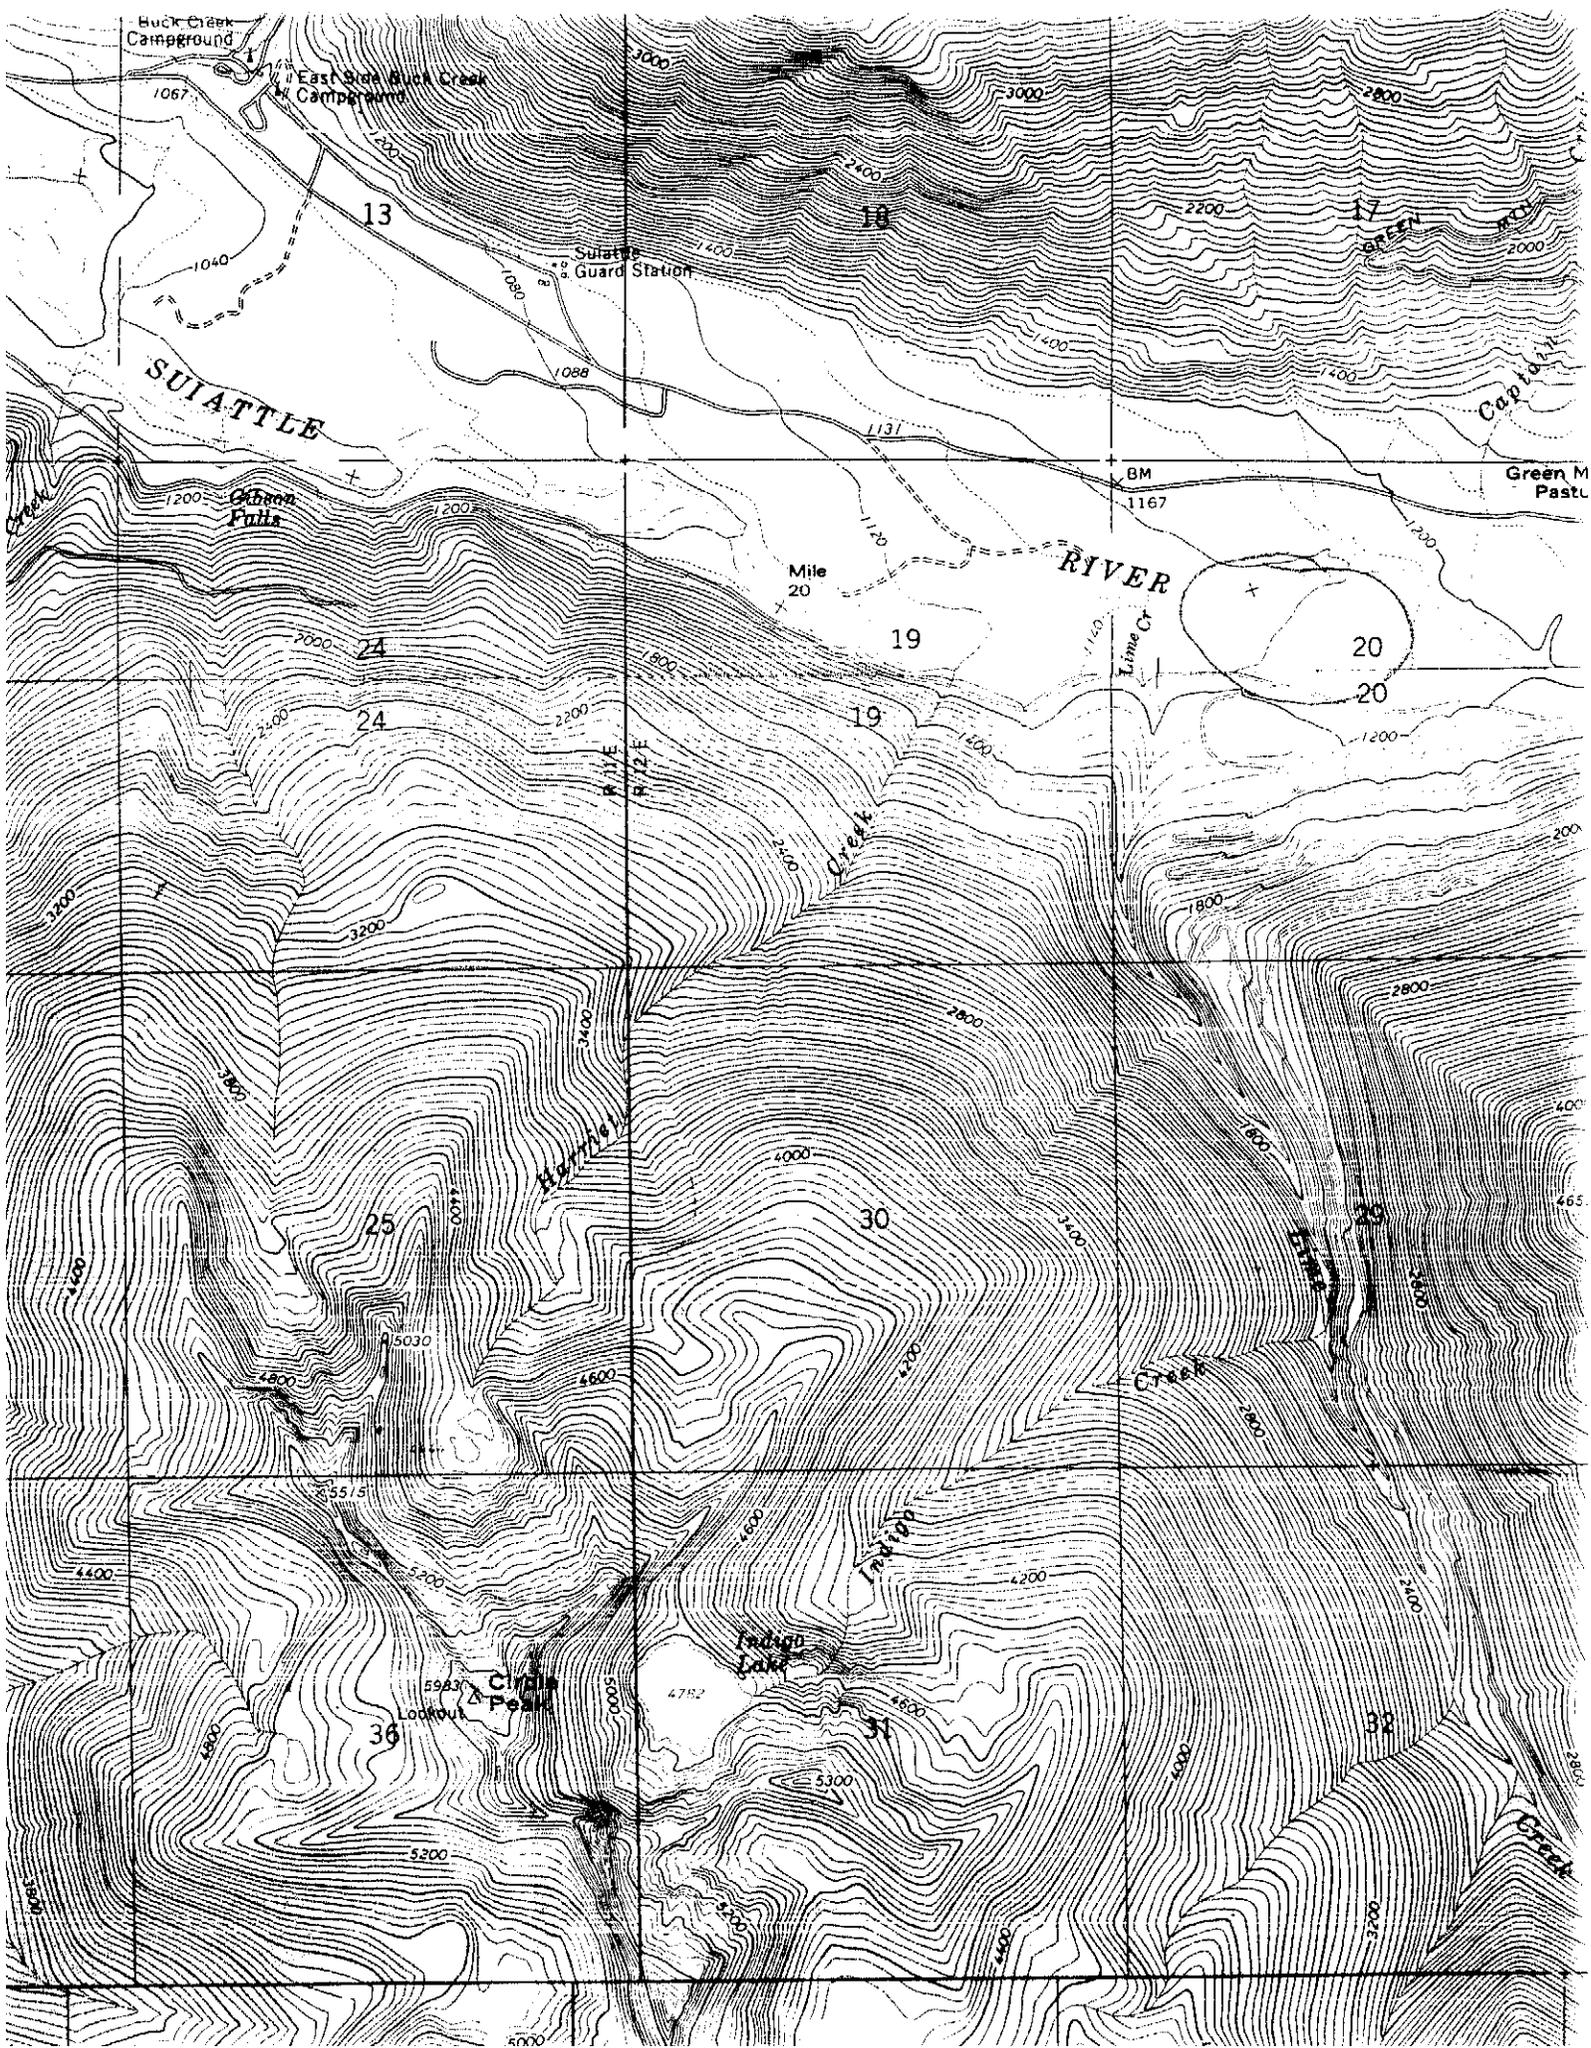

Buck Creek Campground

East Side Buck Creek Campground

Suiattle Guard Station

SUIATLE

Green Falls

RIVER

Green M Pasture

Mile 20

Lime Cr

Hammer

Indian Lake

5983
Lookout

4752

5300

Indian Creek


SU₆ LB4

7/25/95

B. Barkdull

Scale 1" = 33 meters


NW20, T32N, R12E

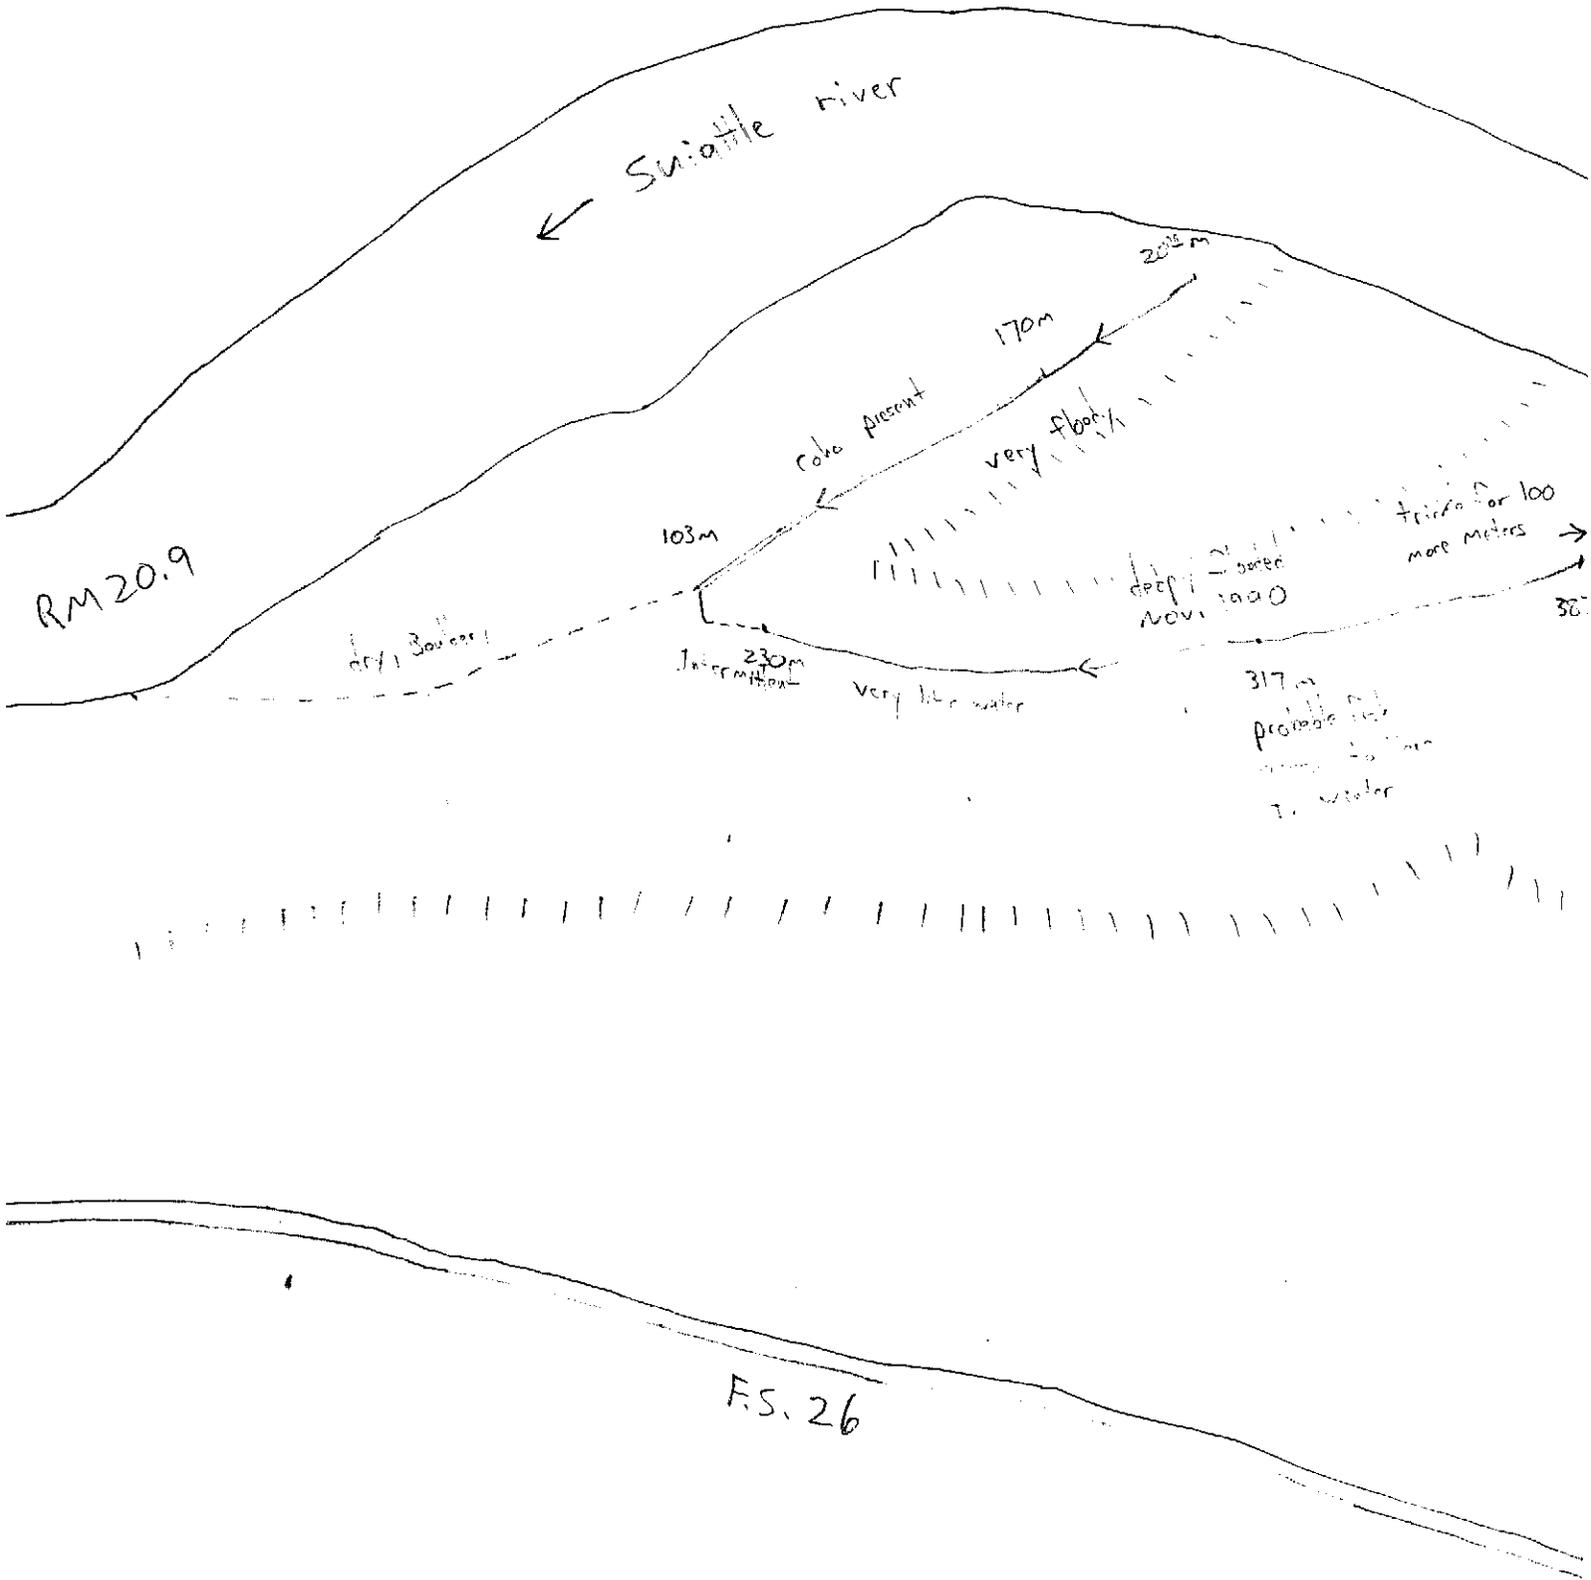

S46 LB4

NW 20 T32N R12E

RM. 20.9

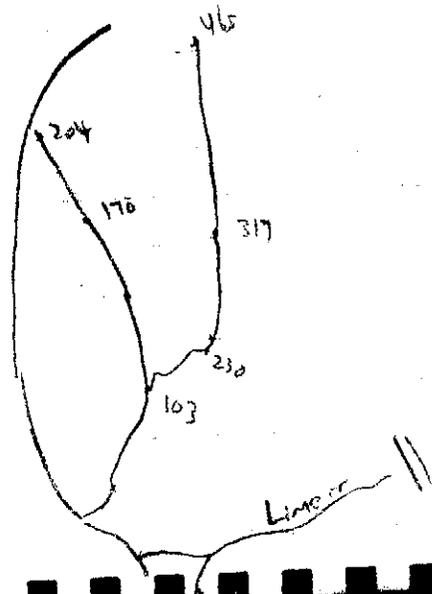

7/25/95 ch. out above lime cre
0.0 dry ch 8'
103 dry CW 6' ave. at base, water
170^{RO} WW 4', ch 8 rock present
204 WW 1' ch 8 very little water
not active side ch. at present
204 LB.
230 CW 10' some puddles w/ fish
317 CW 3' water
387 WW 6' ch 8 water Building Foot
438 WW 8' ch 12 ch increasing in size
465 WW 2' ch 12 end of water

flood prone site, very little sp.
gravel